

East Coast Rover Co.

13 Merrill Drive
Rockland, ME 04841
www.eastcoastrover.com

207-594-8086
207-594-8120 fax
info@eastcoastrover.com

1994 NAS 90ST #71
SALDV2281RA934152

79,275 :miles in
79,356 :miles out

WORK ORDERS:

- Transport to ECR (DONE)
- Repair Check Engine Light (DONE)
 - CODES:
 - Invalid fault
 - 02 sensor fault bank A
 - Misfire fault
 - Idle stepper motor fault
- Replace spark plugs with correct units (DONE)
 - Set plug gap correctly (was .060)
 - Gasket goop was incorrectly used on plug threads, remove
- Replace faulty 02 sensor (DONE)
- Set base idle correctly (DONE)
- Replace cap, rotor and plug wires (DONE)
- Set timing correctly (DONE)
 - Install distributor correctly (was 180° out)
- Install new injectors (DONE)
- Clean PCV system (DONE)
 - Replace flame trap and foam element
- Replace valve cover gaskets (DONE)
- Replace air filter (DONE)

ADDITIONS:

- Install ROX oil cooler lines (DONE)
- Change engine oil and filter (DONE)
- Perform Mechanical Evaluation (DONE)
- Repair glaring items from Evaluation (DONE)
- Flush brake fluid (DONE)
- Flush clutch fluid (DONE)
- Replace drive belts (DONE)
- Replace radiator (DONE)
- Install missing clutch heat shield (DONE)
- Change swivel ball CV grease (DONE)
- Rebuild steering box drop arm (DONE)
- Replace front pinion seal (DONE)

- Replace transfer case front output seal (DONE)
- Tie up seat belt warning wire (DONE)
- Replace rear brake pads (DONE)
- Replace damaged fuel tank breather hose (DONE)
- Repair driver's seat belt latch (DONE)
- Tighten rear view mirror (DONE)
- Repair hazard switch (DONE)
- Weld seat frames (DONE)
- Replace driver's seat base (DONE)
- Replace kick panel trim (DONE)
- Repair front marker lamps (DONE)
- Repair plate lamp (DONE)
- Lubricate transfer case linkage (DONE)
- Replace interior lamp (DONE)
 - Replace 1x door switch
- Replace wiper drives (DONE)

NOTES:

- No top was sent
- RF fender scuff
- Tailgate is pushed in badly
- No rear cage section (no possibility to make seat belts work)